Kohta Ueno

Hybrid Foundation Retrofits

Building America Experts Meeting
Foundations: Research Results and Builder's Handbook Review
November 15, 2011, Minneapolis, MN

Background

Background

- Space conditioning energy use for basements
- Known moisture-safe solutions (previous research)
- Persistent bulk water (leakage) issues
- Retrofits of existing foundations
  - Especially uneven wall (rubble stone) foundations
- "Hybrid" insulation and bulk water control assemblies

Foundations w. bulk water issues

- Severe and rapid damage to interior insulation and finishes due to bulk water intrusion

Insulation Location Choices

- Retrofits: interior insulation is often the only available option

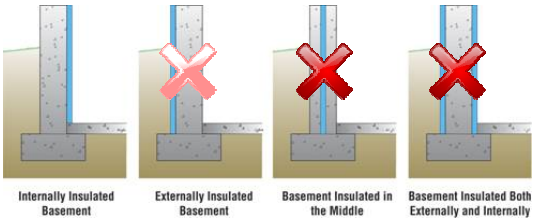

Basement Insulation Location

- 4.6 ACH50; 2129 CFM 50 total; 1100 CFM 50 through floor
- 8.5 ACH50; 3590 CFM 50 total; 1740 CFM 50 through floor

Basement Insulation Problems

- Wintertime interior moisture condensation (like above-grade walls)
- Condensation at bottom of wall (thermal lag of soil)
- Lack of drying of assembly (moisture from concrete and soil); soil is at 100% RH
- Soil gas condensation
- Liquid water through wall

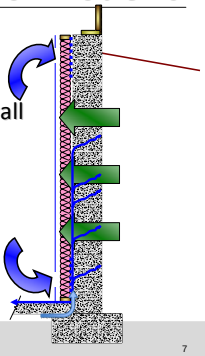

Hybrid Foundation Retrofits 7

Priorities for Dealing with Water

- Damage Functions (In Order of Importance)
- Liquid Water
  - Control from exterior—drainage, grading
- Capillary Water ("wicking")
- Air-Transported Moisture
- Vapor Diffusion
- General rules; can vary on case-to-case basis

Hybrid Foundation Retrofits 8

Freezing/Frost Heave Issues

- Interior insulation reduces heat flux → colder ground temperatures/deeper frost penetration
- Frost damage unlikely <60" extreme frost depth
- Inward frost heave impossible → directional heave
- Adfreezing similar: can occur on unheated structures. Heated → heat flux still outwards (although reduced)
- Canadian BETT study (1980s)

Hybrid Fou

Freezing/Frost Heave Issues

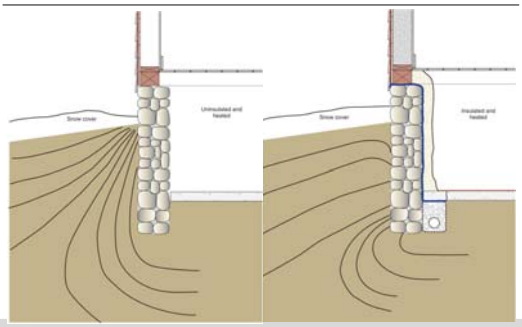

Hybrid Foundation Retrofits 10

Freezing/Frost Heave Issues

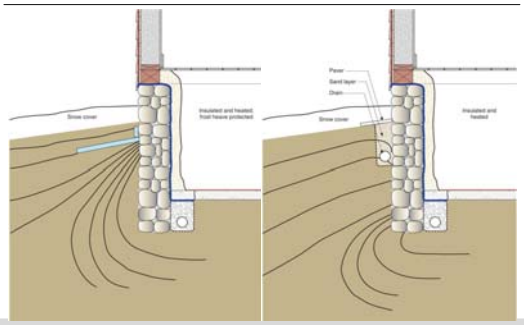

Hybrid Foundation Retrofits 11

Previous Work

- Trade press: interior perimeter drainage
  - Drains slab and wall: no air barrier between sub-slab and interior
- AVID System (Air/Vapor/Insulation/Drainage)
  - Interior drainage; half-height insulation
- Goldberg & Farkas (2004)
  - Interior 0.5 PCF spray foam
  - Typically good performance/low moisture accumulation
  - Zone 7 frosting on above-grade portion (insulation/foundation)

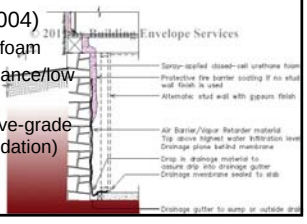

Hybrid Fou

Recommended Designs & Variants

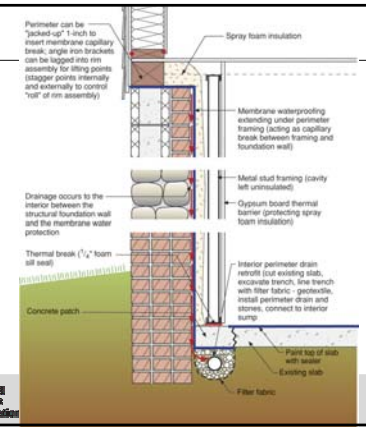

Interior Rubble Retrofit

Interior Rubble Retrofit

Interior Rubble Retrofit

Interior Rubble Retrofit

Interior Rubble Retrofit

Air Gap Membrane Variant

- Spray foam sufficiently stiff at typ. thickness (2" +)
- XPS basement slab perimeter insulation
- Spray foam forms concrete slab thermal break
- Beam pocket detail (air seal from subslab)

Flat Surface Walls

- Spacer mesh to provide drainage behind foam
- Drainage space must be airtight
- Alternate: XPS with channels and filter fabric

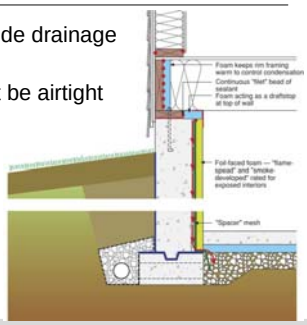

Partial Drainage Detail

- Insulated slab on top of existing slab
- No membrane up wall surface
- Wet vs. dry basement?
- Light gauge steel framing interior wall

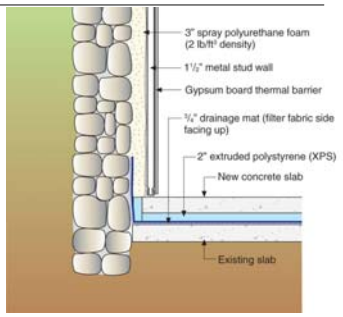

Partial Drainage Detail

- Sump must be connected to drainage mesh
- Air leakage around drainage space termination (interior chimney)

Non-Drained Detail

- "Substantially dry" basement
- Judgment call
- Steel studs clear of spray foam

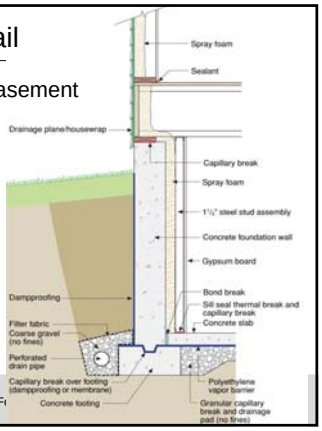

Spray foam basement insulation

- Open cell
  - Climate specific
- Closed cell

Guidance Flowchart

- Rough guidelines
- User judgment required

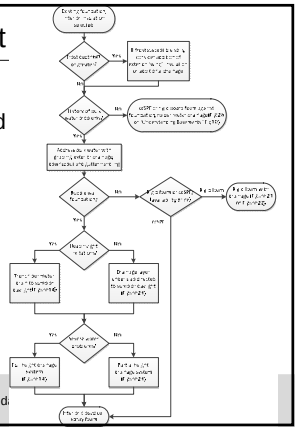

Hybrid Found

Additional Research Topics

Hybrid Foundation Retrofits 27

Hygrothermal Simulations

- Moisture emissions before/after interior ccSPF
  - No drainage layer—spray foam only
  - kg/m^2·year
  - Constant and variable interior T/RH

2.8 liters day uninsulated vs. 0.3 l/day insulated

Family 4 = 10-15 l/day

Slows down capillary mortar erosion?

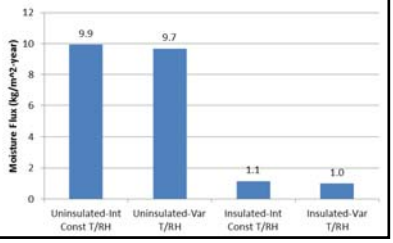

Sill Beam Moisture Durability

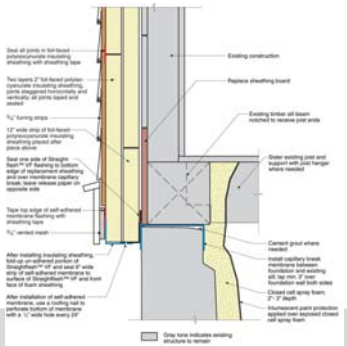

29

Sill Beam Moisture Durability

"This building has been around for the last 100 years…"

Hybrid Foundation Retrofits 30

Sill Beam Moisture Durability

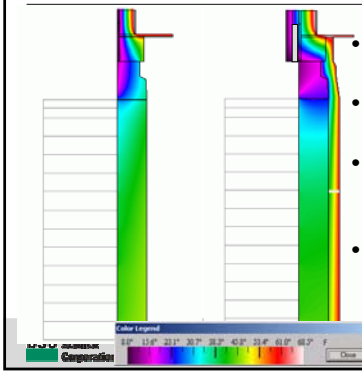

- Sill-to-foundation surface colder
- Less drying available
- But greater protection from bulk water
- Permeable insulation detail?

31

Field Survey Work

- Existing foundation 1996 to 2009, Zone 5A
- Variety of interior ccSPF foundation insulation
- Temperatures and RHs (summer measurement)
  - Basement/crawl space dewpoint vs. above grade
  - Behind foam ~80-90% consistently (not 100%)
- Disassembly: no damage seen
  - Rubble stone walls are not air barriers!

32

Field Survey Work

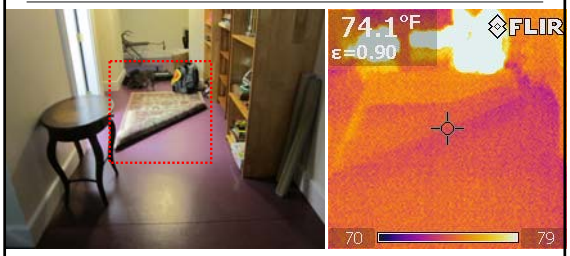

- Sub slab insulation reduces risk of moisture issues (carpets on slabs; cardboard boxes)

Hybrid Foundation Retrofits 33

Further Work

- Mature technology; extensive track record
- Frost damage to foundations in very cold (DOE Zones 6 & 7)—"Where is the edge?"
- Decision to use drainage layer—"historically dry" basement, etc.
- Efflorescence/mortar erosion—sufficiently slowed by reduced evaporation?
- Sill beam drying in interior retrofits; capillary break requirement guidelines?

Hybrid Foundation Retrofits 34

Questions?

Kohta Ueno
kohta@buildingscience.com

This presentation is based research covered in BSC TO2 7.7 Hybrid Foundation Insulation

Hybrid Foundation Retrofits 35